



PR-3000 Series

Pallet Jack Digital Scale

Operation Manual

Version 1.2
February 13, 2004

Contents subject to change without notice.

Salter Brecknell Weighing Products
1000 Armstrong Drive
Fairmont, MN 56031
Tel (800) 637-0529
Tel (507) 238-8702
Fax (507) 238-8271

E-mail: sales@salterbrecknell.com
Web: www.salterbrecknell.com

TABLE OF CONTENTS

		<u>Page</u>
Chapter 1:	Introduction to the PALLET RUNNER 3000 Pallet Jack Scale	4
Chapter 2:	Getting Started	5
Chapter 3:	Operation	6
3.1	Display	6
3.1.1	Liquid Crystal Display (LCD)	6
3.2	Keyboard	7
3.2.1	Function Keys	7
3.3	General Scale Operation	7
3.3.1	Weighing an Item	7
3.3.2	Taring an Item	7,8
Chapter 4:	Advanced Features and Operation	9
4.1	Piece Counting	9
Chapter 5:	Scale Configuration	10
5.1	Scale Configuration Overview	10,11
5.2	User (“A”) Menu	12
5.2.1	Entering the User Menu	10
5.2.2	Navigating in the User Menu	10
5.2.3	Notes on the User Menu	11
5.2.4	Exiting the User Menu	11
5.3	Factory Setup (“F”) Menu	13,14,15
Chapter 6:	Scale Calibration	16
6.1	Scale Calibration Overview	16
6.2	Zero Calibration (F16)	16
6.3	Span Calibration (F17)	16

Appendix A: Specifications	18
Appendix B: Serial Port Information	18
Appendix C: Error Messages.....	19
C.1 Error Messages.....	19
C.1.1 Operator Errors	19
Appendix D: Notes on Rechargeable Battery	20
D.1 Overview	20
D.2 When to charge the internal battery.....	20
D.3 How to charge the internal battery	20
D.4 How long to charge the internal battery	20

LIST OF FIGURES

1-1 PALLET RUNNER 3000 Front Panel	4
3-1 PALLET RUNNER 3000 Display Detail	6
3-2 Function Keys Layout	7
5-1 PALLET RUNNER 3000 Main Circuit Board Overview	10
5-2 User Menu Key Assignments	11
5-3 User Menu Chart	12
6-1 Calibration Mode Key Assignments	16

LIST OF TABLES

1-1 PALLET RUNNER 3000 Information.....	4
3-1 PALLET RUNNER 3000 Annunciator Definitions.....	6
5-1 User Menu Chart	12,13,14,15

CHAPTER 1: INTRODUCTION TO THE PALLET RUNNER 3000 PALLET JACK SCALE

The PALLET RUNNER 3000 Series Scale is a general purpose, industrial grade pallet weighing scale. Featuring complete portability utilizing 2-6 Volt internal batteries, push button tare, and an easy to use piece-counting function.


The display type, enclosure type and scale capacity information can be found in Table 1-1.

All PALLET RUNNER 3000 model scales are factory tested and calibrated prior to delivery. Therefore calibration is not required after unpacking the scale. A small amount of preparation is necessary before the scale can be used. You will find this information in Chapter 2. Please read these instructions carefully and completely, prior to using the scale.

Prior to using the scale, please read this user’s guide carefully and completely. Store the manual in a safe and convenient place so it will be available if you have questions concerning the operation of the scale.

MODEL	DISPLAY TYPE	ENCLOSURE TYPE	CAPACITY / GRADUATION
PALLET RUNNER 3000	LCD (liquid crystal display), 0.8” tall	Carbon Steel NEMA 12 rated	3000 x 1 lb

TABLE 1-1: PALLET RUNNER 3000 Information

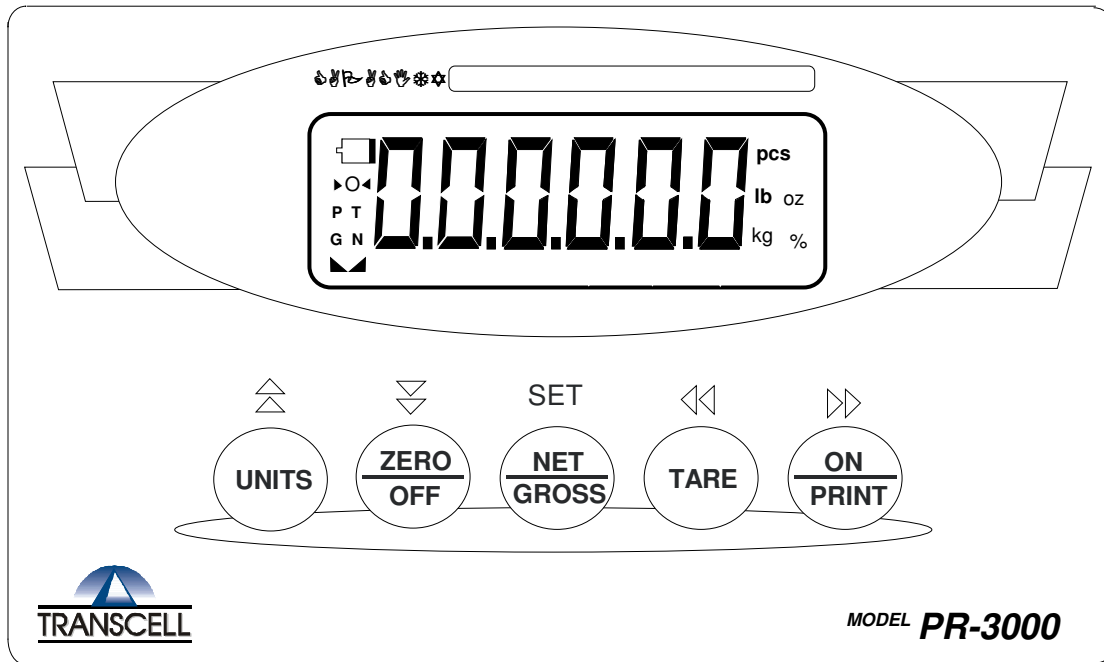

CHAPTER 2: GETTING STARTED

After unpacking the scale, a small amount of preparation is required before the scale can be used. All PALLET RUNNER 3000 models are factory tested and calibrated prior to delivery.

1. Remove all packaging from scale.
2. Position the scale on a firm, flat surface.
3. Lower the forks by squeezing the hand control upwards. The hand control is located at the top of the swivel handle.
4. Turn the scale's power ON to begin use. (If the display is not at a zero weight reading, press the Zero key).
5. Slide the Pallet Runner forks under any standard pallet. (For optimum weighing accuracy, the forks must be at least $\frac{3}{4}$ of their length under the pallet to be weighed).
6. Engage the lift mechanism by lowering the hand control. It may be necessary to hit the release button before doing so.
7. Lift the pallet by cranking the handle in an UP/DOWN direction a minimum of 3 complete cycles. Now view the display for the weight value.

NOTE: Your PALLET RUNNER 3000 will automatically shut off after five minutes of non-use. To change this setting, see Chapter 5.

For best results, be sure to follow these general guidelines:

- If using the AC adapter, do not share an AC outlet with electrical noise producing equipment, such as refrigeration units. This includes products with electrical motors and/or relays.
- Do not place the scale in an area with changing ambient temperature and/or high humidity.
- Do not place the scale in an area with vibrating equipment.
- You may obtain a weight reading while moving, however for the best accuracy a static weighment is advised.

CHAPTER 3: OPERATION

3.1 DISPLAY

The PALLET RUNNER 3000 utilizes a 6 digit LCD (Liquid Crystal Display) to display the weight and system information Table 3-1 summarizes the display annunciators.

3.1.1 LIQUID CRYSTAL DISPLAY (LCD)

Figure 3-1 shows the display detail of the PALLET RUNNER 3000 LCD.

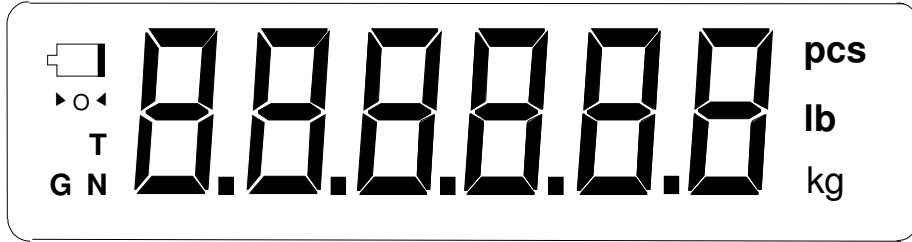


FIGURE 3-1: PALLET RUNNER 3000 LCD Detail

LCD Annunciator	MEANING
→0←	Better known as the “Center of Zero” annunciator, this light is active whenever the displayed weight is within ± 0.25 divisions of true zero.
N	Indicates that the scale is displaying net weight.
G	Indicates that the scale is displaying gross weight.
T	Indicates that a tare weight has been established in the system.
lb, kg, pcs	Indicates the unit of the displayed weight. .
	This light is on whenever the scale is stable.
	Indicates that the battery voltage is too low for normal operation. Use the AC adapter to re-charge the battery.

TABLE 3-1: PALLET RUNNER 3000 Annunciator Definitions

3.2 KEYBOARD

The keyboard is composed of five function keys. Refer to Figure 3-2 for the overall layout and key locations.



FIGURE 3-2: Function Keys Layout

3.2.1 FUNCTION KEYS

Units – This key toggles the scale among the available weight units. Available weight units as shipped from the factory include lb, kg and pieces.

Zero/OFF – When held for three seconds, powers the scale OFF. Otherwise, this key sets the scale to display zero provided the following conditions are met:

1. The scale is displaying Gross weight.
2. The scale is not in motion.
3. The scale is not in overload (see Appendix C for error codes).

Net/Gross - This key toggles the scale between Gross weight and Net weight only if a Tare has been established.

Tare - This key is used to establish a Tare provided the following conditions are met:

1. The scale is not at or below Gross zero.
2. The scale is not in motion.
3. The scale is not in overload (see Appendix C for error codes).

ON/Print – This key is used to turn the scale ON. (The Print function is not available on this model).

3.3 GENERAL SCALE OPERATION

3.3.1 WEIGHING AN ITEM

1. Select the desired weighing unit by pressing the UNITS key until that unit is indicated on the display.
2. If necessary, press the ZERO key to obtain a weight reading of zero.
3. Raise the object to be weighed off the floor and allow the weight indication to stabilize. If the item weight exceeds the scale's weight capacity, it displays "□□□□□□".
4. Read the weight shown on the display.

3.3.2 TARING AN ITEM

To weigh an item in a container or on a pallet, the weight of that container or pallet must first be subtracted from the overall weight to obtain an accurate weight reading. This is known as taring.

1. Select the desired weighing unit by pressing the UNITS key until that unit is indicated on the display.
2. If necessary, press the ZERO key to obtain a weight reading of zero.

3. Raise the empty container or pallet off the floor and allow the weight indication to stabilize.
4. Press the TARE key. The display shows zero weight and turns the NET annunciator on.
5. Place the material to be weighed on the container or pallet, raise it off the floor and allow the weight indication to stabilize.
6. Read the weight shown on the display.
7. You may toggle between the gross weight and the net weight by pressing the NET/GROSS key.

CHAPTER 4: ADVANCED FEATURES AND OPERATION

4.1 PIECE COUNTING

This mode is used to indicate the number of pieces of an item you have placed on the scale's forks and is accessed by pressing the UNITS key. To ensure accuracy, the parts you are counting must be consistent in weight.

The scale uses the sampling method to determine the average piece weight (APW) of the items you wish to count. When sampling items, always count the parts in your hand and place them on the scale all at once. If the APW of the items is too light or the total weight of the sample is too light, accuracy cannot be guaranteed. You will get an error message, but piece counting will still be allowed.

1. Press the UNITS key until "PCS" is indicated on the display. If a previous sample has not been taken, the scale will display "10 0". If a previous sample has been taken, the scale will display the current number of pieces on the platform.
2. If the items you will be counting require a container or pallet, you must first tare the container or pallet off by pressing the TARE key.
3. If the screen does not show "10 0", press the TARE key once. The scale is prompting you to place ten identical items on the scale's forks.

NOTE: If you wish to change the sample number, simply press the NET/GROSS key repeatedly until the desired sample number appears. Available choices are 5, 10, 25, 50 and 100.

4. Place the sample items on the scale's forks all at once and allow the weight indication to stabilize. Once this is done, the zero indicated after the sample number will change to a "-". For example, "10 -".
5. Press the NET/GROSS key to take the sample. If the sample size is large enough, the scale now displays the number of pieces on the forks. If it does not, the scale briefly displays "Add" and automatically increments the sample size. Repeat Step #4 with the new sample size.

NOTE: If the scale continues to display "Add" even after sampling 100 pieces, the unit weight of the items you wish to count is too light for your scale to process accurately.

6. To exit the piece count mode, press the UNITS key. The APW will remain in scale memory until you repeat Steps # 2 or #3.

CHAPTER 5: SCALE CONFIGURATION

5.1 SCALE CONFIGURATION OVERVIEW

The scale contains two main setup menus: The User (“A”) menu - which configures the serial communication port and enables some user options - and the Factory Setup (“F”) menu.

5.2 USER (“A” & “F”) MENUS

5.2.1 ENTERING THE USER MENU “A” AND “F”

1. Power off the indicator by pressing and holding the down ZERO/OFF key for 3 seconds.
2. Remove the top digital display cover and find the black switch. The switch is located on top of the silver canned A/D converter. (Refer to Figure 5.1 for switch location)



3. Place the switch in the down position as shown at right.
4. Power on the indicator by pressing the ON key. The indicator shows “ F 1” to indicate that you are in Setup Menu mode.

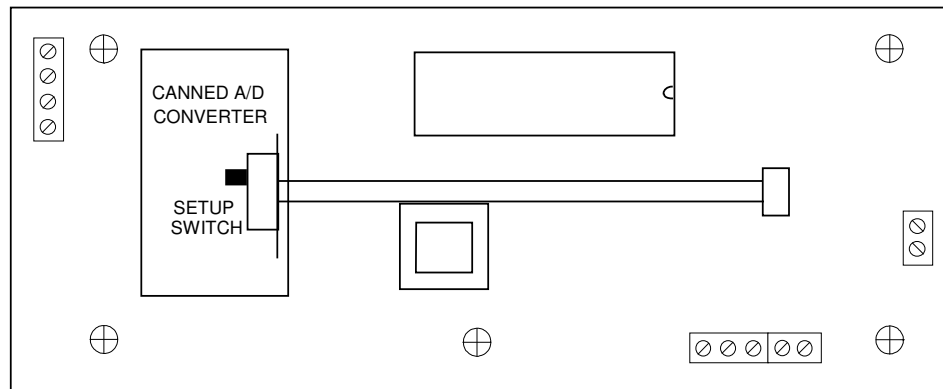


Figure 5-1: PALLET RUNNER 3000 Main Circuit Board Overview

5.2.2 NAVIGATING IN THE A & F USER MENUS

Use the directional keys shown in Figure 5-2 to move around in the A and F User Menus.

1. To move to the selection level, press the ZERO/OFF (down) key once. The current saved selection is shown.
2. To view the available selections for A and F menus, use the TARE (left) or ON/PRINT (right) key to move through the selection field.
3. To save a new selection, press the NET/GROSS (Save) key .To exit without saving, press the UNITS (up) key to return to the A OR F heading.

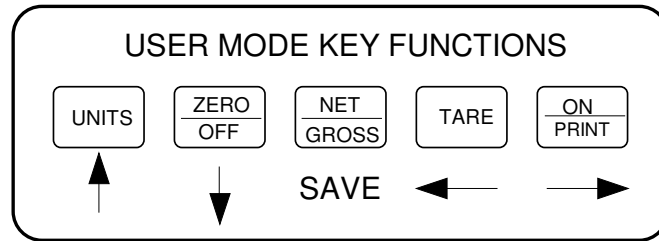


Figure 5-2: User Menu Key Assignments

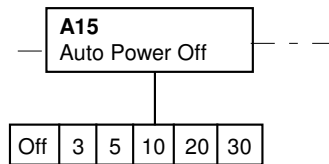


Figure 5-3: User Menu Chart

5.2.3 NOTES ON THE USER MENU


1. Detailed descriptions of the user menu parameters can be found in Table 5-1. Factory-set defaults are shown in bold with a checkmark (✓).

5.2.4 EXITING THE USER MENU

1. Power off the indicator by pressing and holding the down ZERO/OFF key for 3 seconds.
2. Move the Setup/Calibration Switch back to its original position.
3. Power on the indicator by pressing the ON/PRINT key. The display will go through a digit check, then settle into Normal Operating mode. All front panel keys will now return to their normal mode of operation.


5.3 FACTORY SETUP (“A”) MENU Table 5-1: User Menu Chart

NAME/CODE	DESCRIPTION	CODE/VALUE
A1 Baud Rate	Selects the baud rate for the data transmission through both serial ports (COM1 And COM2)	1200 2400 √ 4800 9600
A2 Data Bits and Parity	Selects the number of data bits and parity of serial transmission. "8n" = 8 data bits with no parity bit and one stop bit "7O" = 7 data bits with odd parity bit and one stop bit "7E" = 7 data bits with even parity bit and one stop bit "7n" = 7 data bits with no parity bit and two stop bits	8n √ 7O 7E 7n
A3 COM1 Mode	Selects the mode of the COM1 serial port: Refer to appendix B for more information "0" = Full duplex "1" = Print ticket mode	0 √ 1
A4 ID No. Enable	Allows the ID number to be disabled in the Print Ticket mode. Valid only when A3 is set to "1". "0" = Disable the ID No. "1" = Enable the ID No.	0 √ 1
A5 ID No. Entry	Actuates the function that allows entry of a new ID number. Valid only when A3 is set to "1". Pressing the ZERO key to scroll down one level begins the sequence.	0 – 199999 123456 √
A6 No. of line feeds	Actuates the function that allows entry of the desired number of line feeds to be printed in the Print Ticket Mode. Valid only when A3 is set to "1". Pressing the ZERO key to scroll down one level begins the sequence.	0-99 5 √
A7 Handshaking Enable	Enables hardware handshaking for Print Ticket Mode. Valid only when A3 is set to "1". "0" = Disable "1" = Enable	0 √ 1
A14 Display Check	Actuates the function that illuminates all digit segments, decimal points, and LCD annunciators in a test sequence.	Press ZERO to begin
A15 Auto off	Enables the selection of time in minutes before power down when no activity has occurred. Pressing the ZERO key to scroll down one level begins the sequence.	OFF √ 3, 5, 10, 20,30
A16 Mode of serial transmisson	Allows selection of continuous serial transmission or demand transmission.	"C" = continuous "D" = demand

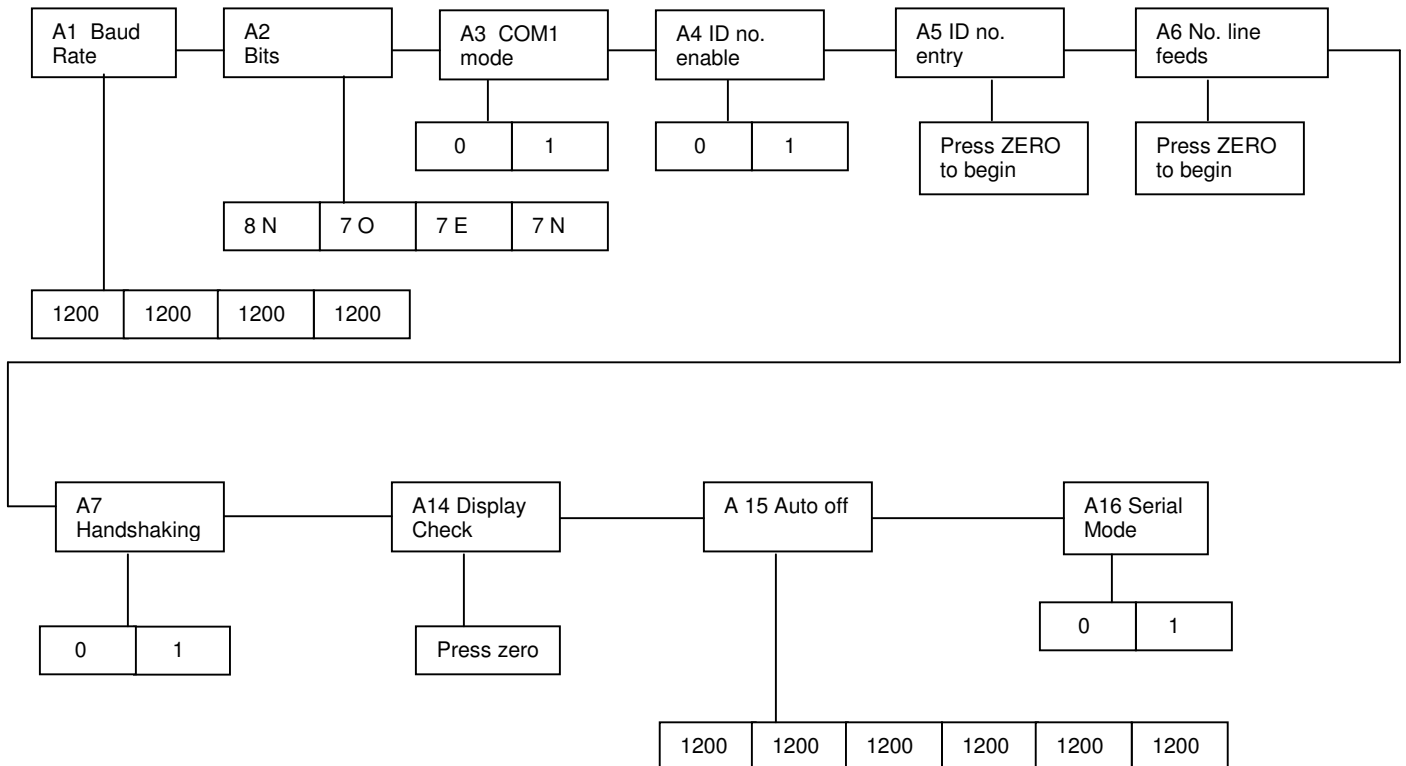

NAME/CODE	DESCRIPTION	CODE/VALUE
F1 Graduations	Specifies number of full-scale graduations. Value should be consistent with legal requirements and environmental limits on the useful system resolution.	500 1,000 1,500 2,000 2,500 3,000 4,000 5,000 6,000 8,000 10,000 ✓ 12,000 20,000 30,000 40,000 50,000
F2 Span Gain	Span Gain is related to A/D integration time. The larger the span gain, the higher the internal resolution, but the slower the update speed. Note that the scale must be re-calibrated whenever this parameter is altered. See Appendix C for more information.	25 50 75 100 ✓ 150 200
F3 Zero Track Band	Selects the range within which the scale will automatically zero. Note that the scale must be in standstill to automatically zero. Selections are in Display Divisions.	0d 0.5d ✓ 1d 3d 5d
F4 Zero Range	Selects the range within which the scale may be zeroed. Note that the indicator must be in standstill to zero the scale.	100% ✓ 1.9%
F5 Motion Band	Sets the level at which motion is detected by comparing the present display update with the previous one. If motion is not detected for two seconds or more, scale is in standstill and can process a Print or Zero command. Maximum value varies depending on local regulations.	1d ✓ 3d 5d 10d
F6 Digital Filter	Averages weight readings to produce higher stability. The higher the filter number, the greater the stability but the slower the response time. Choose 8 or 12 unless a very fast response is needed. Use the "Auto" setting to automatically determine the filter length as you are weighing.	1 2 4 8 12 16 24
F7 Overload Limit	Selects the desired formula which determines the point at which the indicator shows overload. All selections are based on the primary unit selected in F8. "FS" = Full scale in primary units.	FS FS + 2% ✓ FS + 1d FS + 9d
F8 Calib. Unit	Selects the primary base unit to be used in the calibration process. Also the default unit for normal operation. "1" = primary unit is lb. "2" = primary unit is in kg.	1 ✓ 2

NAME/CODE	DESCRIPTION	CODE/VALUE
F9 Display Divisions	Determines the desired weight increments. Value should be consistent with legal requirements.	1√ 2 5
F10 Decimal Pt.	Determines location of the decimal point.	0√ 0.0 0.00 0.000 0.0000 00
F11 Custom Unit Multiplier	Actuates the function that allows you to enter a multiplier for the custom unit. Scrolling down with the ZERO key one level begins the procedure.	Press ZERO key to begin sequence 1√
F12 Custom Unit Enable	Used to enable or disable the custom unit whenever the UNITS key is pressed. This feature must be disabled for commercial applications. "0" = Disable custom unit "1" = Enable custom unit	0 1√
F13 Piece Count Enable	Used to enable or disable the piece count feature. This feature must be disabled for commercial applications. "0" = Disable piece count "1" = Enable piece count	0√ 1
F14 lb/kg Conversion Enable	Used to enable or disable the lb to kg conversion whenever the UNITS key is pressed. "0" = Disable conversion "1" = Enable conversion	0 1√
F16 Zero Calibration	Places indicator into the zero calibration routine. Scrolling down with the ZERO key one level begins the procedure.	Press ZERO key to begin sequence
F17 Span Calibration	Places indicator into the span calibration routine. Scrolling down with the ZERO key one level begins the procedure.	Press ZERO key to begin sequence
F18 View Calibration	Actuates the function that allows you to view both the zero and span calibration value. The values displayed in this function are valid only after Calibration (F16 & F17) has been successfully completed. Scrolling down with the ZERO key one level begins the procedure.	Press ZERO key to begin sequence
F19 Key-in Zero	Allows you to key-in known zero calibration value in case of memory loss in the field. Scrolling down with the ZERO key one level begins the procedure.	Press ZERO key to begin sequence
F20 Key-in Span	Allows you to key-in a known span calibration value in case of memory loss in the field. Scrolling down with the ZERO key one level begins the procedure.	Press ZERO key to begin sequence
F21 Factory Reset	This sub-menu will reset all parameters in the "F" and "A" menu to the default settings. USE WITH CAUTION! Password = 38181	Press the ZERO key twice to execute.

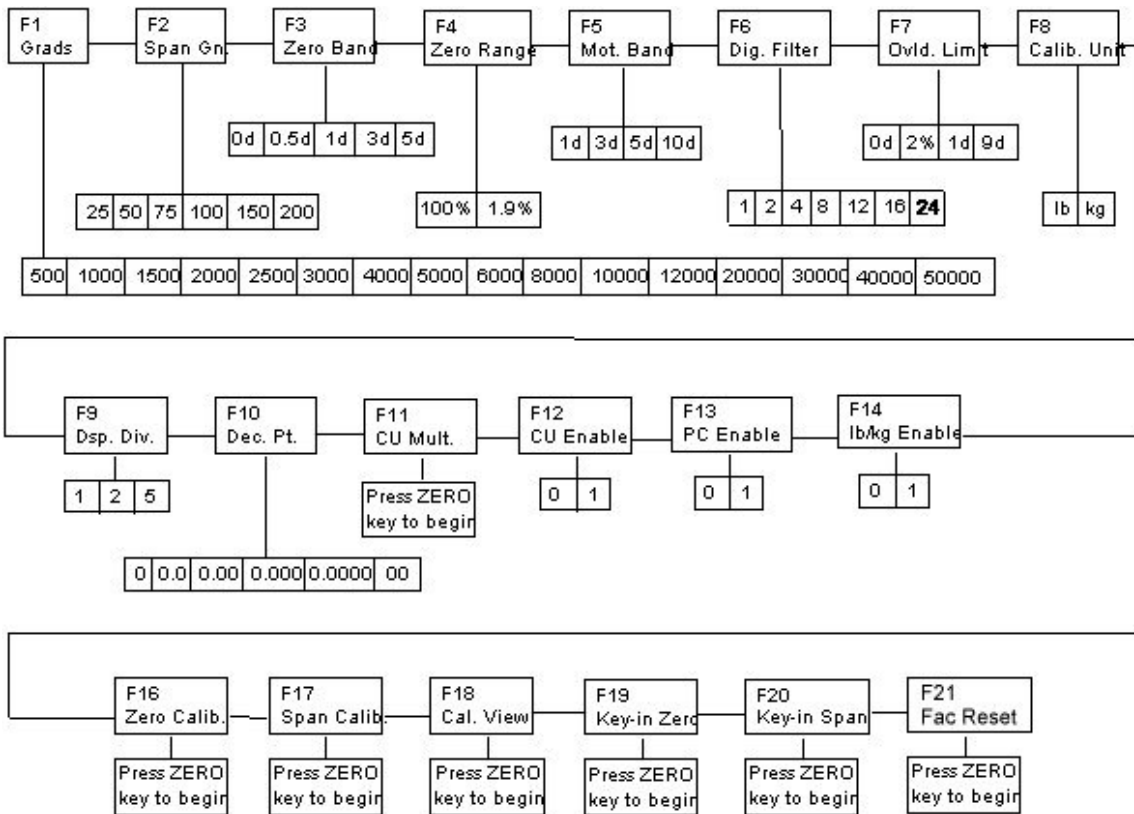

CHAPTER 6: SCALE CALIBRATION

6.1 SCALE CALIBRATION OVERVIEW

The PALLET RUNNER 3000 scale may be calibrated with any precision test weight between 30 pounds and 3000 pounds. The recommended test weight is 2000 pounds, but in general the larger the test weight, the more accurate the scale will be.

Before you can calibrate the scale, you must enter the Setup Menu. See Section 5.2.1 for instructions on how to do this.

6.2 ZERO CALIBRATION (F16)

1. While in the Setup mode, scroll to "**F 16**", then scroll down once using the ZERO/OFF key to enter zero calibration menu. The display will momentarily show "**C 0**" followed by a value. This value is the internal A/D count and can prove useful when trying to troubleshoot setup problems.
2. After making sure that there are no test weights on the platform, press the ZERO/OFF key again to zero out the displayed value.
3. Press the NET/GROSS key to save the zero point value. The display will show "**EndC0**" momentarily, then revert back up to F16. At this time, proceed to the F17 span calibration to complete indicator calibration.

6.3 SPAN CALIBRATION (F17)

1. While in the Setup mode, scroll to "**F 17**", then scroll down once using the ZERO/OFF key to enter span calibration menu.
2. The display will momentarily show "**C 1**" for the span calibration, followed by a value with one flashing digit. Place the test weight on the weighing mechanism.
3. Use the four directional keys (shown in Figure 6-1 below) to adjust the displayed value to the actual test weight value. Increase the flashing digit by pressing the UNITS key. Decrease the flashing digit by pressing the ZERO/OFF key. Pressing the ON/PRINT key or the TARE key will change the position of the flashing digit.

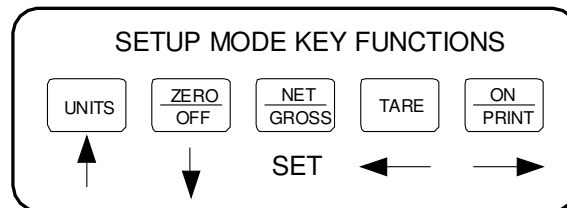


Figure 6-1: Setup Menu Key Assignments

4. After setting the exact value, press the NET/GROSS key to save the value.
5. If the calibration was successful, the display will show "**EndC1**" momentarily, then revert back up to F17.

6. If the calibration was *not* successful, one of the error messages below will appear. Take the indicated action to correct the problem, then perform a new calibration.

"Err0" - The calibration test weight or the adjusted keyed-in weight is larger than the full capacity of the scale. Change the calibration test weight or check the input data.

"Err1" - The calibration test weight or the adjusted keyed-in weight is smaller than 1% of the full capacity of the scale. Change the calibration test weight or check the input data.

"Err2" – The calibration test weight does not match the keyed-in weight. This could also be due to an internal fault and/or damaged load cell. Or you could have simply forgotten to place the test weight on the scale before pressing the NET/GROSS key.

APPENDIX A: SPECIFICATIONS

CONSTRUCTION:

Pallet Jack: High Tensile Steel

Indicator: A-36 Carbon Steel

DISPLAY:

6 digit, 7-segment LCD

KEYPAD:

5-key Tactile Keypad

OVER CAPACITY ANNUNCIATION:

103% of Full Scale Capacity

OPERATING TEMPERATURE RANGE:

14°F to 104°F

(-10°C to 40°C)

POWER SOURCE:

2 internal 6V lead acid batteries

AC Adapter, 12VDC, 800 mA (Also acts as charger)

CHARGER: See "Power Source" above

Charge Period: See Appendix D

WEIGHT:

Net Weight: 300 lb (136kg)

Shipping Weight: 330 lb (150 kg)

DIMENSIONS:

Forks: 42" x 27" x 3"

APPENDIX B: SERIAL PORT INFORMATION

APPENDIX B is not applicable to this scale product.

APPENDIX C: DISPLAYED ERROR CODES

CODE	MODE	MEANING / POSSIBLE SOLUTION
□□□□□□	Normal Operating Mode	Gross Overload. A weight greater than the rated capacity has been applied to the scale. Remove the weight from the platter or try re-calibrating the scale. Otherwise, check for a bad load cell connection or possible load cell damage due to overloading.
Err 0	Span Calibration Mode (F17)	Keyed-in weight value is less than 1% of full-scale capacity. Use a larger test weight or check keyed-in value.
Err 1	Span Calibration Mode (F17)	Keyed-in weight value is larger than full-scale capacity. Use a smaller test weight or check keyed-in value.
Err 2	Span Calibration Mode (F17)	There is not enough load cell signal to produce the internal counts necessary to properly calibrate the scale. First check all load connections. Use F16 mode to view internal counts. See Appendix C for more information.
Err 3	All Modes	Non-volatile memory read error. One or more setup parameters have been lost.
Err 4	All Modes	Non-volatile memory write error. Indicator needs service.
Err 7	Initialization	No reading from the ADC. Could indicate a damaged load cell.
Err 9	Normal Operating Mode	Span calibration value has been lost. Re-calibrate the scale.
Err 10	Initialization or Setting Code Entry	Indicator cannot read serial number. Indicator must be returned for service.
Err 11	Initialization	Serial number mismatch. Re-enter setting code from product ID tag.
Err 12	Initialization or Setting Code Entry	Invalid setting code. Re-enter proper setting code from product ID tag.
Err 13	Setting Code Entry	Non-volatile memory is in write-protect mode. Toggle position of Setup/Calibration Switch (See Chapter 5).

Note: Contact Service Department at Transcell for instructions on how to re-enter setting code.

APPENDIX D: NOTES ON RECHARGEABLE BATTERY

D.1 OVERVIEW

Your scale contains two internal lead-acid rechargeable batteries connected in parallel. Before using the scale for the first time, please charge the battery overnight.

The scale's battery should operate for about 40 hours if left on continuously. Therefore, greater usage times can be achieved by selecting an appropriate Auto Power Off Period under **A15** of the User Menu.

The battery can be charged while ON or OFF and the scale can be operated while it's charging.

D.2 WHEN TO CHARGE THE INTERNAL BATTERY

1. The best time to charge the sealed lead-acid type battery is any time the scale is not in use. You do not have to wait for the Low Battery Indication – in fact it's best you don't. Charging the battery when the scale is not in use keeps the battery "fresh" and is the recommended way to manage your scale's battery.
2. When the battery needs to be charged, the Low Battery Indicator will appear in the upper left-hand corner of the display. The scale may be used for an additional 15 to 30 minutes without damage to the internal battery. ***If the scale is used for more than 30 minutes after a low battery indication, permanent damage may occur to the battery and/or the battery may not accept a charge.***

NOTE: When a low battery indication occurs, the scale automatically shuts off after 5 minutes of idle use.

D.3 HOW TO CHARGE THE INTERNAL BATTERY

1. Connect the charger (AC Adapter 12 VDC, 800mA) to the scale, and then plug the charger into an AC outlet. ***Make sure that the AC voltage appearing at the wall outlet matches the input voltage marked on the AC adapter.***
2. After the charging period expires, unplug the charger from the AC outlet, then from the scale. The scale is now ready for use under its own battery power.

NOTE: The charger may be left connected to the scale indefinitely without damage to the internal battery.

D.4 HOW LONG TO CHARGE THE INTERNAL BATTERY

In general, the battery should be allowed to charge a minimum of 1.5 hours for every hour of use.

If you discharge the battery below 50% and do not allow the proper time for charging, you may notice a decline in the usage period. This is due to the battery's reluctance to accept a charge.